

# PRODUCT DATA SHEET

MM-150-01



## Y-Förbindning / Y-Bonds



Area (mm <sup>2</sup> )	Längd (mm) Length (mm)	SAFE nr. SAFE no.	BV nr.	Mtrl.	Antal/förp. Qty/pack	Skruvsats* Screwset*	Rek. lodpinne Rec. Braze pin
2x25	77	SAFE 3043	0624665	Koppar, Cu	50	X	2xSAFE 10011
2x20	77	SAFE 3046	-	Galv.stål, Galv. Steel	50		2xSAFE 10011
2x25	87	SAFE 3044	-	Koppar, Cu	50	X	2xSAFE 10011
2x25	87	SAFE 3045	-	Koppar, Cu	50		2xSAFE 10011

Presskabelsko för montering av 10mm<sup>2</sup> kabel, SAFE 6052 / BV 0626531. 50st/förp.  
Cable lug for mounting 10mm<sup>2</sup> cable, SAFE 6052. 50pcs/pack.

\*Skruvsats innehåller:

- 1st M8x20 syrafast sexkantskruv.
- 1st M8 syrafast låsmutter.
- 2st 8,4x16x1,5 syrafasta brickor.



\*Screwset includes:



- 1pc M8x20 stainless bolt.
- 1pc M8 stainless locking nut.
- 2pcs 8,4x16x1,5 stainless washer.




## T-förbindningar / T-connectors

typ/type C


typ/type D

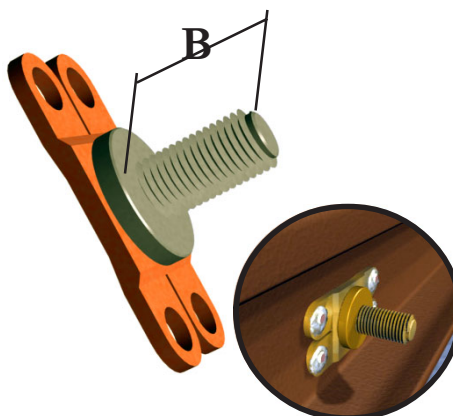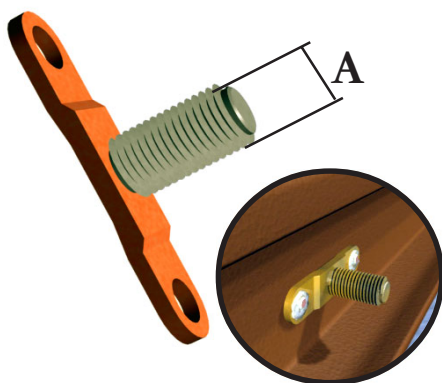

 T-förbindningen används då man vill ha en demonterbar anslutning.

Den består av en platta i koppar samt en gängad anslutningsdel. Förbindningen pinnlöds sedan mot arbetsmaterialet.

Den gängade anslutningsdelen är av antingen mässing eller rostfritt stål.

 T-CONNECTORS are used when a

disconnectable bond is needed. T-Connectors consist of a copper plate on which a thread is welded, each plate is retained by two or four braze pins and allows larger (up to 300 mm<sup>2</sup>) cable sizes to be used. To braze the largest T-Connector, with 4 brazings, it takes not more than 1-2 min inclusive grinding for the earthing and brazing area.

SAFE nr. SAFE No	Type	A	B	Skruvmaterial Thread material	Antal/förp. Qty/pack.	Rek. lodpinne Rec. braze pin
SAFE 5005	C	M8	18	Mässing Brass	100	2st 10011
SAFE 5007	C	M12	35	Mässing Brass	100	2st 10011
SAFE 5031	C	M16	27	Rostfritt stål Stainless Steel	50	2st 10131
SAFE 5016	D	M16	26	Rostfritt stål Stainless Steel	50	4st 10131
SAFE 5022	D	M16	32	Rostfritt stål Stainless Steel	50	4st 10131